Firmware Update for TSST TS-L632H or TS-L632P Optical Drive

<Issue>


1. Unable to burn CD-R media with iTune when using a TSST TS-L632H drive. A message "Unknown Error 2131" may be displayed. This has been fixed.
2. Enhancement has been made to DVD recovery function.

TS-L632H are model without 'Label Flash' function.
TS-L632P are model with 'Label Flash' function.

<Procedure to Update Firmware>

Before updating ODD firmware, check the ODD number and FW version.

- Run TOSHIBA Disk Creator
- Select 'Audio CD'
- Select 'Disk' - 'Disk Information'

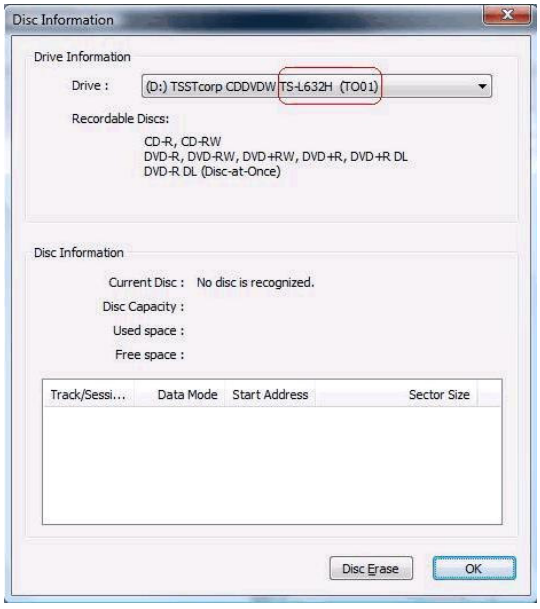

- If displayed as 'TS-L632H (TO01)' or 'TS-L632H (TO02)', proceed with firmware updated.
- If displayed as 'TS-L632P (TO01)', proceed with firmware updated.
- If displayed ODD other than 'TS-L632H' or 'TS-L632H', or firmware version is the latest, update is not possible.

<Procedure>

1. Click on the link which corresponds to the ODD model number. That is TSL632H or TSL632P. Download TSL632H.ZIP or TSL632P.ZIP.
2. Unzip and run 'TSL632H_TO03.exe' for TS-L632H or 'TSL632P_TO02.exe' for TS-L632P in the respective folder under windows.
3. Follow the instructions on screen.

<Confirm Updated Firmware Version>

1. Run TOSHIBA disk Creator, Select 'Audio CD' -> Select 'Disk' - 'Disk Information'.
2. If 'TS-L632H (TO03)' or 'TS-L632P (TO02)', Update is completed..